



CHEVROLET


ASSEMBLY INSTRUCTIONS

3940195

1969 CAMARO 12000 SERIES

- 1 3921433 HOSE ASM.
- 3954225 PIPE ASM. -RPO L34, L35 & L78
- 2 3906193 GROMMET
- 3 6295266 HARN. ASM. -ENG. WRG.
- 4 3904227 FITTING
- 5 444052 ELBOW
- 6 444030 BUSHING
- 7 6295058 HARN. ASM. -GEN. & LAMP

- 8 3954228 BRACKET
- 9 3817006 SCREW ASM. -RPO L35
- 10 1513462 GAUGE ASM.
- 11 120614 NUT
- 12 138479 L. WASHER
- 13 121534 SLEEVE
- 14 3906197 NUT

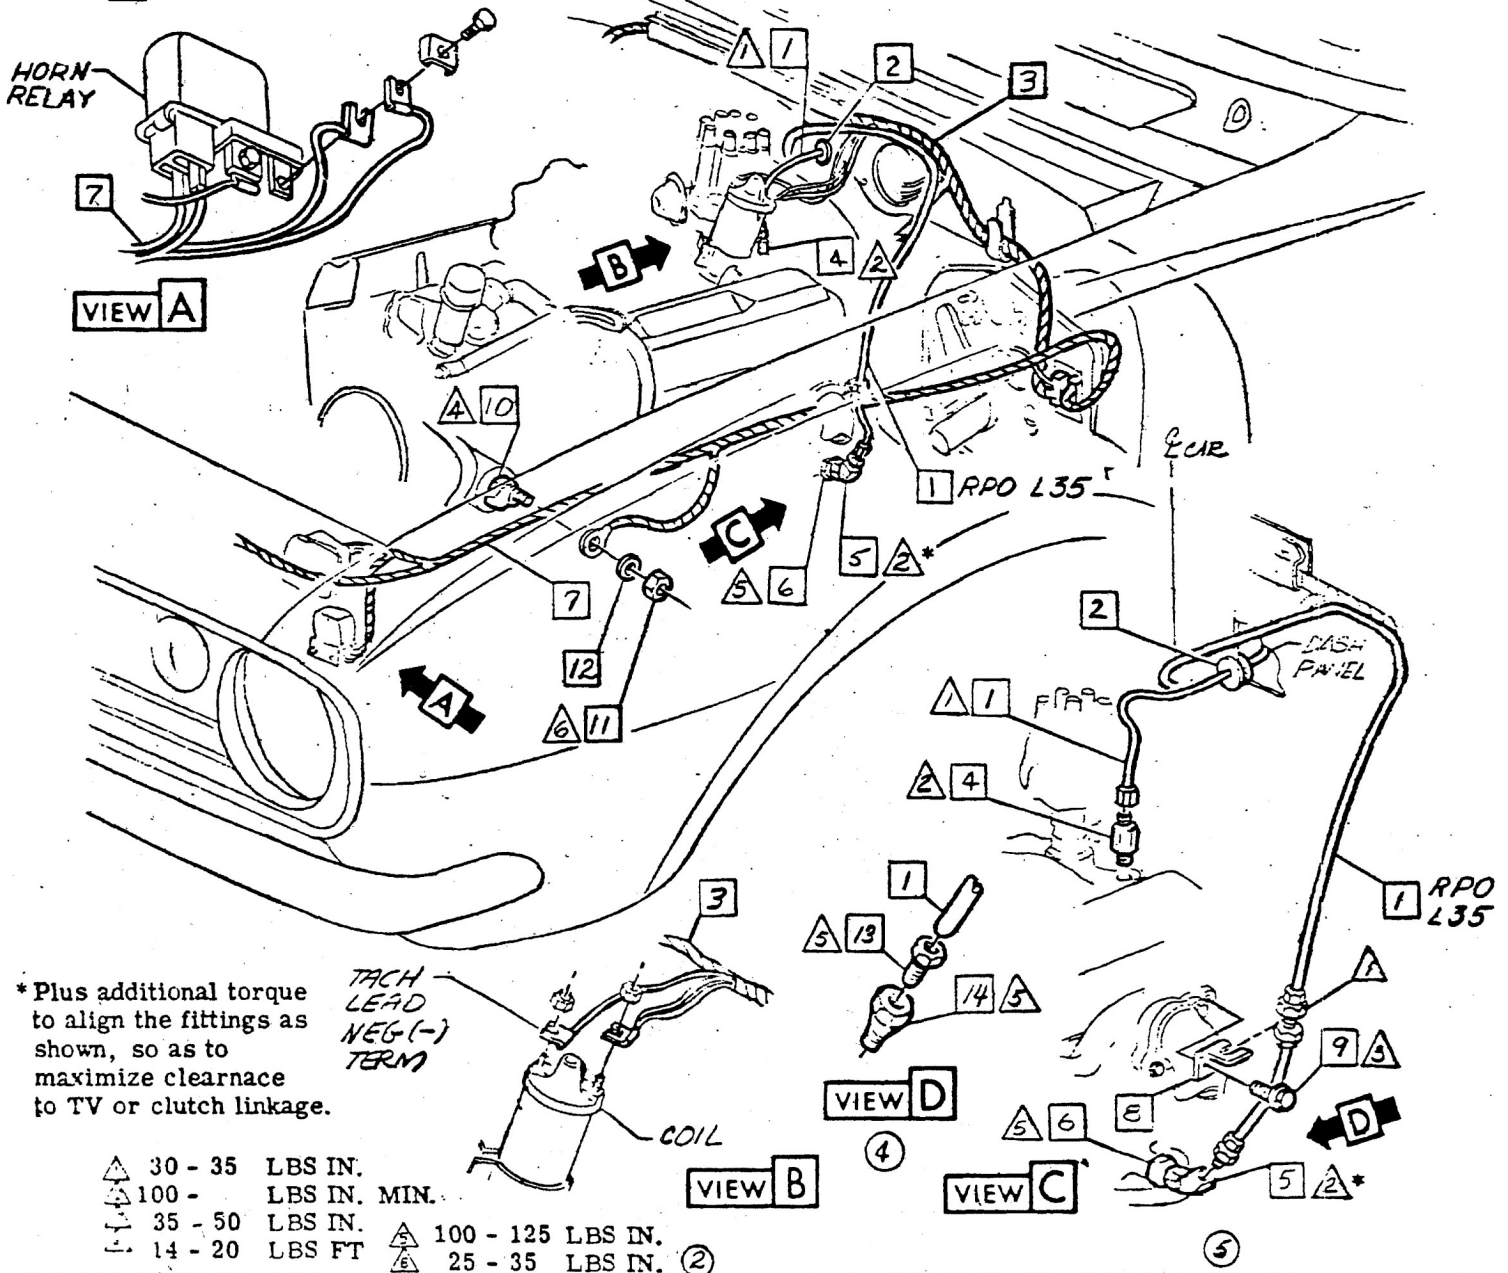

* Plus additional torque to align the fittings as shown, so as to maximize clearance to TV or clutch linkage.

TACH LEAD
NEG (-)
TERM

- △ 30 - 35 LBS IN.
- △ 100 - LBS IN. MIN.
- △ 35 - 50 LBS IN.
- △ 14 - 20 LBS FT
- △ 100 - 125 LBS IN.
- △ 25 - 35 LBS IN.

CHEVROLET MOTOR DIVISION, GMC		UPC	DATE	SYM	REVISION RECORD	AUTH.	DR	CK
FRT COMPT. CONSOLE INSTRUMENT CLUSTER-FRT WRG & OIL PRESS HOSE		U17	5-15-68	1	REDRAWN REDESIGNED 39435, 39447, 98224, ACC			
12000 V-8 ENGINE		A3	7-18-68	2	TORQUES 5 & 6 ADDED			TH
				3	ITEMS 13 & 14 ADDED			ER
				4	VIEW D ADDED			
				5	DOCUMENTATION RMVD			RC
DWS 4-29								
LATE REL 5								
REF A1								
L-85716								
L-89015								